



**Traralgon Laboratory**  
 5 Church Street  
 Traralgon Vic 3844  
 email: mwlmail@ghd.com.au  
 web: www.ghd.com.au/ghdgeotechnics  
 Tel: (03) 5136 5900  
 Fax: (03) 5136 5999

# Aggregate/Soil Test Report

**Report No: TRA1800163**

**Issue No: 1**

*This report replaces all previous issues of report no 'TRA1800163'.*

**Client:** Gippsland Premium Quarries Pty Ltd  
 PO Box 1  
 Neerim Junction Vic 3832

**Project:** QA Testing Sand - GPQ



Accredited for compliance with ISO / IEC 17025 - Testing

NATA Accredited Laboratory Number: 4092  
 Approved Signatory: Rod Smith (Laboratory Manager)  
 Date of Issue: 8/02/2018  
 THIS DOCUMENT SHALL NOT BE REPRODUCED EXCEPT IN FULL

## Sample Details

**GHD Sample No** TRA18-0122-01  
**Date Sampled** 06/02/2018  
**Sampled By** Sampled By Client  
**Location** 160 Thurlows Rd, Shady Crk  
**Client Location** Sample ID:318 WSA 351  
**Soil Description** Client Description: Supa Pea Gravel

## Other Test Results

Description	Method	Result	Limits
Moisture Content (%)	AS 1289.2.1.1	2.1	
pH Value (pH)	AS 1289.4.3.1	6.2	


## Particle Size Distribution

AS 1289.3.6.1

**Drying by:** Oven  
**Date Tested:**

**Note:** Sample Washed

Sieve Size	% Passing	Limits
13.2mm	100	
9.5mm	99	
6.7mm	96	
4.75mm	77	
2.36mm	15	
1.18mm	3	
600µm	1	
425µm	1	
300µm	1	
150µm	1	
75µm	1	

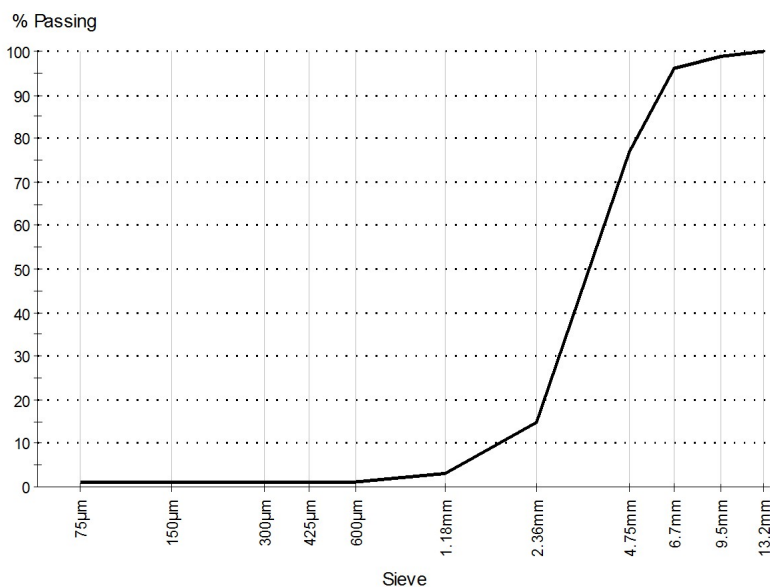

## Comments

N/A